


# B-Series Murphygage® instrument



## Pressure, Vacuum and Temperature Instruments

- 2 in. (51 mm) Dial Gages
- Heavy-duty Rated
- Environmentally Sealed\*
- Pressure Models Up to 400 psi (2.76 MPa) [27.6 bar]
- Temperature Models Up to 440°F (220°C)

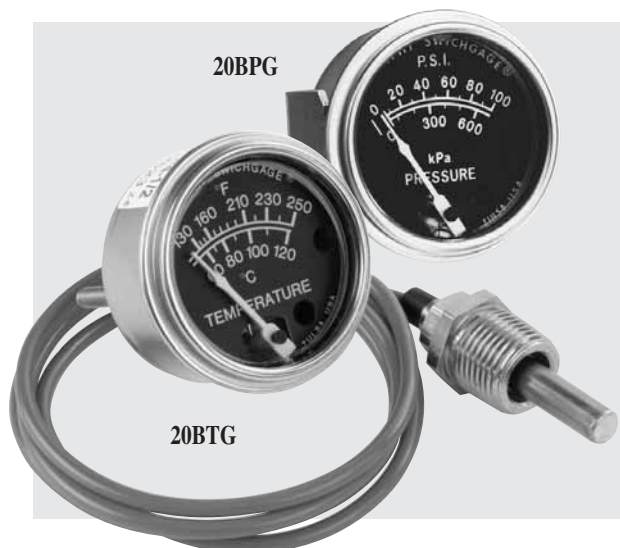

### Description

The B-Series Murphygage® instrument is a high quality, diaphragm-actuated indicating gage. Built by Murphy with the same heavy-duty design as the standard 20 series and 25 series Swichgage® instrument, the B-gage is more compact and is the optimum instrument for gage-only applications. It has a high impact polycarbonate lens, sturdy steel case, and a polished, low-profile stainless steel bezel. Accuracy and protection from moderate over-pressure/over-temperature are assured by a unique, unitized diaphragm chamber, superior quality materials, and the design of the gage movement.

#### Pressure Murphygage® instrument

Pressure changes at the diaphragm convert to accurate mechanical movements that are indicated on an easy to read analog dial. A pulsation dampener in the pressure port helps eliminate pointer flutter; it can be removed for cleaning to maintain the gage's response and accuracy.

#### Vacuum Murphygage® instrument

Available in 0 to 20 or 0 to 30 in. Hg. (0 to -68 or 0 to -102 kPa) vacuum.

#### Temperature Murphygage® instrument

As temperature rises, the fluid in the sensing bulb vaporizes to apply pressure on the diaphragm; the movement translates this vapor pressure to a calibrated reading of temperature on the dial. The standard capillary is copper with a PVC armor. Optional armor covering is galvanized steel or 316 stainless steel (specify). Optional bulb types, adaptor nuts and thermowells are available.†

### Applications

Industrial engines and equipment in Oil Field, Marine, Irrigation, Construction and Trucking industries. Monitoring Engine Coolant, Crankcase Oil, Transmission Oil.

### Specifications

**Dial:** White on black; U.S.A. standard scale is dual scale; others available (see How to Order).

#### Gage Accuracy:

##### Pressure/Vacuum (% of Full Scale):

RANGE	LOWER 1/4	MIDDLE 1/2	UPPER 1/4
≤300 psi (24 Bar)	±3%	±2%	±3%
400 psi (28 Bar)	±3%	±3%	±5%

**Temperature:** See chart on reverse side.

#### Temperature Range:

##### Pressure/Vacuum:

Ambient: -40°F (-40°C) thru 150°F (66°C).

Process: -40°F (-40°C) thru 250°F (121°C).

**Temperature:** See chart on reverse side.

**Maximum Panel Thickness:** 1/4 in. (6 mm).

**Port:** Brass.

**Case:** Plated steel; mounting clamp included (except for direct mount models).

**Bezel:** Polished stainless steel, standard; optional bezels are available (see How to Order).

**Pointer:** White (black dial); black (white dial).

**Lens:** Polycarbonate, high-impact.


**Sensing Element:** Beryllium copper diaphragm.

### Comparison of a Murphygage® instrument to Most Other Gages

The basic difference between the Murphygage® instrument and most other gages is the internal design. The Murphygage® instrument does not rely on the gage case to serve as part of the sensing chamber. The diaphragm (A) which must expand and contract consistently with changing pressures and temperatures, is held firmly in place by the back plate (B) and the mounting plate (C). In most other gages the diaphragm (D) and an expansion retarding plate (E) are soldered directly into the case port and held in place by a locator ring (F). Should the case

receive any damage in this area the diaphragm operation could be affected. However, in the Murphygage® instrument, the diaphragm is protected and securely locked in position.

Another feature of the Murphygage® instrument is the removable pulsation dampener (pressure instruments only) (G) which provides for periodic cleaning when being used with liquids which might cause clogging. Other gages are usually equipped with a non-removable dampener (H).

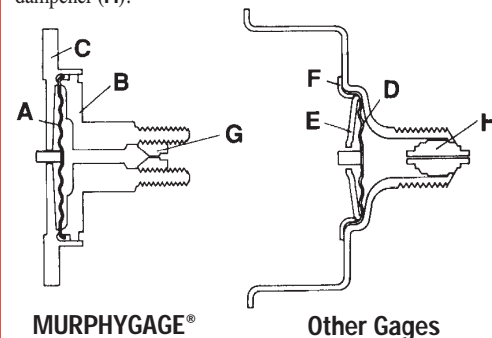

MURPHYGAGE®

Other Gages

### Warranty

A limited warranty on materials and workmanship is given with this FW Murphy product. A copy of the warranty may be viewed or printed by going to [www.fwmurphy.com/support/warranty.htm](http://www.fwmurphy.com/support/warranty.htm)

\* All pressure gages, above 30 psi (200 kPa) [20.0 bar] and all temperature gages, are environmentally sealed and filled with inert gas. This seal protects the mechanism and eliminates "clouding" of the lens from moisture condensation.


\*\* Products covered by this bulletin comply with EMC Council directive 89/336/EEC regarding electromagnetic compatibility except as noted.

† For optional temperature capillary lengths, engine adaptors, sensing bulbs and range combinations, see Murphy bulletin T-8428B.




## Standard Dimensions

### Pressure/Vacuum

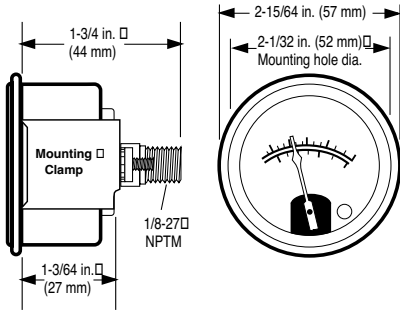

†Standard combinations. See Murphy bulletin T-8428B for optional sensing bulb, engine adaptors and capillary combinations.

### Temperature

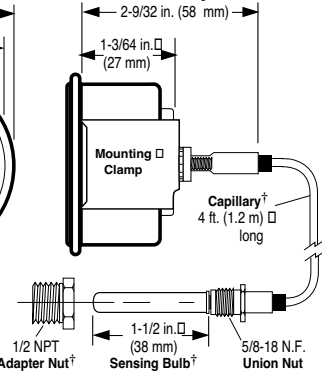

## Temperature Accuracy/Range Chart

Celsius measurements are shown in parenthesis.

RANGE	Lower 1/3 Scale	Middle 1/3	Upper 1/3
32-120 (0-49)	± 12° (± 6)	± 5° (± 2.4°)	± 6° (± 3°)
32-160 (0-71)	± 20° (± 10°)	± 8° (± 4.4°)	± 7° (± 4°)
130-220 (54-104)	± 6°F (± 3°)	± 3° (± 1.6°)	± 4° (± 2°)
130-250 (54-121)	± 9° (± 5°)	± 5° (± 2.4°)	± 4° (± 2°)
140-300 (60-149)	± 10° (± 5.2°)	± 6° (± 3°)	± 5° (± 2.4°)
160-320 (71-160)	± 10° (± 5.2°)	± 5° (± 2.4°)	± 5° (± 2.4°)
180-350 (82-177)	± 12° (± 6°)	± 5° (± 2.4°)	± 5° (± 2.4°)
300-440 (149-227)	± 9° (± 5°)	± 5° (± 2.4°)	± 4° (± 2°)

### MAXIMUM PROCESS TEMPERATURE

RANGE	MAXIMUM PROCESS TEMPERATURE
≤250° (120°)	120% OF FULL SCALE
300° (140°)	350° (198°)
≤320° (160°)	120% OF FULL SCALE

## How to Order

To order, use the diagram below. **NOTE:** List options in ascending alphabetical order (A-Z). Example: **20BTG-IP1-250-4**

Base Model
20BPG = Pressure
20BVG = Vacuum
20BTG = Temperature

Options*
B1 = Black bezel
B2 = Bezel 05051857 (was "HP")
B3 = Bezel 05051836 (was "HBB")
D = Direct mount
IP1 = Light pipe illumination, 12 VDC
IP2 = Light pipe illumination, 24 VDC

\*Options not available on all models or configurations.

### Temperature Capillary Armor Type and Length

#### Capillary Armor Type

Blank = PVC armor, copper capillary  
S = Stainless steel armor, copper capillary

Capillary Length (specify after capillary type; example: "S4")  
4 = 4 ft. (1.2 m)

Specify other length = Available in 2 ft. increments thru 20 ft.; 5 ft. increments above 20 ft. (0.5 metre increments from 1.5-10 metres; 2 metre increments thru 34 metres. Specify "M" following length, i.e. 1.5M.)

### Adapter Nuts<sup>†††</sup>

- 1/8 = 1/8-27 NPT
- 1/4 = 1/4-18 NPT
- 3/8 = 3/8-18 NPT
- 3/8B = 3/8-19 BSPT
- 3/8K = 3/8 NPSF
- = 1/2-14 NPT<sup>††††</sup>
- 1/2B = 1/2-BSPT
- 1/2K = 1/2 NPSF
- 5/8 = 5/8-18 UNF
- 3/4 = 3/4-14 NPT
- 3/4U = 3/4-16 UNF
- 7/8 = 7/8-9 UNC

### Metric

- M10 = 10 mm x 1.5
- M12 = 12 mm x 1.5
- M14 = 14 mm x 1.5
- M16 = 16 mm x 1.5
- M18 = 18 mm x 1.5
- M20 = 20 mm x 1.5
- M22 = 22 mm x 1.5
- M24 = 24 mm x 1.5

††† Specific adapter nut must match the sensing bulb.

†††† Standard.

### Range<sup>††</sup>

Pressure (20BPG) Dual scale (psi/kPa)	Pressure (20BPG) Single scale (bar)	Vacuum (20BVG) Dual scale (in. Hg/kPa)	Temperature (20BTG) Dual scale (°F/°C)	Temperature (20BTG) Single scale (°C)																																																				
<table border="0"> <tr> <td>15 = 0-15</td> <td>0-103</td> </tr> <tr> <td>30 = 0-30</td> <td>0-207</td> </tr> <tr> <td>50 = 0-50</td> <td>0-345</td> </tr> <tr> <td>75 = 0-75</td> <td>0-517</td> </tr> <tr> <td>100 = 0-100</td> <td>0-689</td> </tr> <tr> <td>150 = 0-150</td> <td>0-1.03</td> </tr> <tr> <td>200 = 0-200</td> <td>0-1.38</td> </tr> <tr> <td>300 = 0-300</td> <td>0-2.07</td> </tr> <tr> <td>400 = 0-400</td> <td>0-2.76</td> </tr> </table>	15 = 0-15	0-103	30 = 0-30	0-207	50 = 0-50	0-345	75 = 0-75	0-517	100 = 0-100	0-689	150 = 0-150	0-1.03	200 = 0-200	0-1.38	300 = 0-300	0-2.07	400 = 0-400	0-2.76	<table border="0"> <tr> <td>1B = 0-1 bar</td> </tr> <tr> <td>2B = 0-2 bar</td> </tr> <tr> <td>3.5B = 0-3.5 bar</td> </tr> <tr> <td>5B = 0-5 bar</td> </tr> <tr> <td>7B = 0-7 bar</td> </tr> <tr> <td>10B = 0-10 bar</td> </tr> <tr> <td>14B = 0-14 bar</td> </tr> <tr> <td>20B = 0-20 bar</td> </tr> <tr> <td>28B = 0-28 bar</td> </tr> </table>	1B = 0-1 bar	2B = 0-2 bar	3.5B = 0-3.5 bar	5B = 0-5 bar	7B = 0-7 bar	10B = 0-10 bar	14B = 0-14 bar	20B = 0-20 bar	28B = 0-28 bar	<table border="0"> <tr> <td>20 = 0 to 20</td> <td>0 to -68</td> </tr> <tr> <td>30 = 0 to 30</td> <td>0 to -102</td> </tr> </table>	20 = 0 to 20	0 to -68	30 = 0 to 30	0 to -102	<table border="0"> <tr> <td>120 = 32-120</td> <td>0-49</td> </tr> <tr> <td>160 = 32-160</td> <td>0-71</td> </tr> <tr> <td>220 = 130-220</td> <td>54-104</td> </tr> <tr> <td>250 = 130-250</td> <td>60-121</td> </tr> <tr> <td>300 = 140-300</td> <td>60-149</td> </tr> <tr> <td>320 = 160-320</td> <td>71-160</td> </tr> <tr> <td>350 = 180-350</td> <td>71-160</td> </tr> <tr> <td>440 = 300-440</td> <td>149-227</td> </tr> </table>	120 = 32-120	0-49	160 = 32-160	0-71	220 = 130-220	54-104	250 = 130-250	60-121	300 = 140-300	60-149	320 = 160-320	71-160	350 = 180-350	71-160	440 = 300-440	149-227	<table border="0"> <tr> <td>70C = 0-70°C</td> </tr> <tr> <td>100C = 45-100°C</td> </tr> <tr> <td>120C = 50-120°C</td> </tr> <tr> <td>140C = 60-140°C</td> </tr> <tr> <td>160C = 70-160°C</td> </tr> </table>	70C = 0-70°C	100C = 45-100°C	120C = 50-120°C	140C = 60-140°C	160C = 70-160°C
15 = 0-15	0-103																																																							
30 = 0-30	0-207																																																							
50 = 0-50	0-345																																																							
75 = 0-75	0-517																																																							
100 = 0-100	0-689																																																							
150 = 0-150	0-1.03																																																							
200 = 0-200	0-1.38																																																							
300 = 0-300	0-2.07																																																							
400 = 0-400	0-2.76																																																							
1B = 0-1 bar																																																								
2B = 0-2 bar																																																								
3.5B = 0-3.5 bar																																																								
5B = 0-5 bar																																																								
7B = 0-7 bar																																																								
10B = 0-10 bar																																																								
14B = 0-14 bar																																																								
20B = 0-20 bar																																																								
28B = 0-28 bar																																																								
20 = 0 to 20	0 to -68																																																							
30 = 0 to 30	0 to -102																																																							
120 = 32-120	0-49																																																							
160 = 32-160	0-71																																																							
220 = 130-220	54-104																																																							
250 = 130-250	60-121																																																							
300 = 140-300	60-149																																																							
320 = 160-320	71-160																																																							
350 = 180-350	71-160																																																							
440 = 300-440	149-227																																																							
70C = 0-70°C																																																								
100C = 45-100°C																																																								
120C = 50-120°C																																																								
140C = 60-140°C																																																								
160C = 70-160°C																																																								

†† Consult factory for availability of dials other than psi/kPa or °F/°C. Select scale so your normal operating value is in the middle half of the scale.



北京

信德迈科技(北京)有限公司 CNMEC Technology  
北京朝阳区胜古中路2号金基业大厦201室  
邮编: 100029  
电话: 010-8428 2935 13910962635  
传真: 010-8428 8762  
主页: //www.cnmec.com  
电子邮件: sales@cnmec.biz